



OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>ABNORMAL</b>
FLUID CONDITION	<b>ABNORMAL</b>

Machine Id  
**PRO2 TRUCK 18-MCG-R-01-001-M**  
 Component  
**CHEVY 407 CU IN 725 HP PRO POWER Front Gasoline Engine**  
 Fluid  
**VALVOLINE VR-1 RACING MOTOR OIL SAE 20W50 (15 LTR)**

**RECOMMENDATION**

The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Test	UOM	Method	Limit/Abn	#3 Current	#2 History1	#1 History2
Sample Number				WC112686	WC112672	WC111755
Sample Date				06 Aug 2018	10 Jul 2018	18 Jun 2018
Machine Age	hrs			4	0	3
Oil Age	hrs			0	46	1
Filter Age	hrs			0	46	1
Oil Changed				Changed	Changed	Changed
Filter Changed				Changed	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	MARGINAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185	>150	66	94	137
Chromium	ppm	ASTM D5185	>20	4.3	6.9	10
Nickel	ppm	ASTM D5185	>5	0.2	0.8	1.5
Titanium	ppm	ASTM D5185		19	0.7	1.4
Silver	ppm	ASTM D5185	>2	0.0	0.0	0.0
Aluminum	ppm	ASTM D5185	>40	23	35	74
Lead	ppm	ASTM D5185	>50	618	971	2528
Copper	ppm	ASTM D5185	>155	29	59	97
Tin	ppm	ASTM D5185	>10	0.0	0.0	0.0
Vanadium	ppm	ASTM D5185		0.2	0.0	0.0
White Metal	scalar	Visual	NONE	LIGHT	---	LIGHT
Babbitt	scalar	Visual	NONE	NONE	---	NONE

**CONTAMINATION**









There is a moderate amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

Silicon	ppm	ASTM D5185	>30	20	22	40
Potassium	ppm	ASTM D5185	>20	2.9	7.3	3.2
Fuel	%	ASTM D3524	>4.0	▲ 4.1	▲ 2.9	▲ 2.6
Glycol	%	ASTM D2982		0.0	0.0	NEG
Soot %	%	ASTM D7686		0	0	0
Nitration (PA)	%	ASTM D7624	>100	30	23	24
Sulfation (PA)	%	ASTM D7415	>100	44	63	125
Silt	scalar	Visual	NONE	NONE	---	VLITE
Debris	scalar	Visual	NONE	NONE	---	VLITE
Sand/Dirt	scalar	Visual	NONE	NONE	---	NONE
Appearance	scalar	Visual	NORML	NORML	---	NORML
Odor	scalar	Visual	NORML	NORML	---	NORML
Emulsified Water	scalar	Visual	>0.2	NEG	NEG	NEG

**FLUID CONDITION**

Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

Sodium	ppm	ASTM D5185		72	215	2.2
Boron	ppm	ASTM D5185		128	4.0	13
Barium	ppm	ASTM D5185		0.0	0.0	0.0
Molybdenum	ppm	ASTM D5185		79	101	1.3
Manganese	ppm	ASTM D5185		0.6	1.2	1.1
Magnesium	ppm	ASTM D5185		506	11	12
Calcium	ppm	ASTM D5185	1910	1278	1799	1942
Phosphorus	ppm	ASTM D5185	1300	1131	1082	1286
Zinc	ppm	ASTM D5185	1400	1285	1285	1521
Sulfur	ppm	ASTM D5185		3453	3095	3605
Oxidation (PA)	%	ASTM D7414	>100	51	88	214
Visc @ 100°C	cSt	ASTM D7279	20.5	▲ 14.4	▲ 15.4	15.6

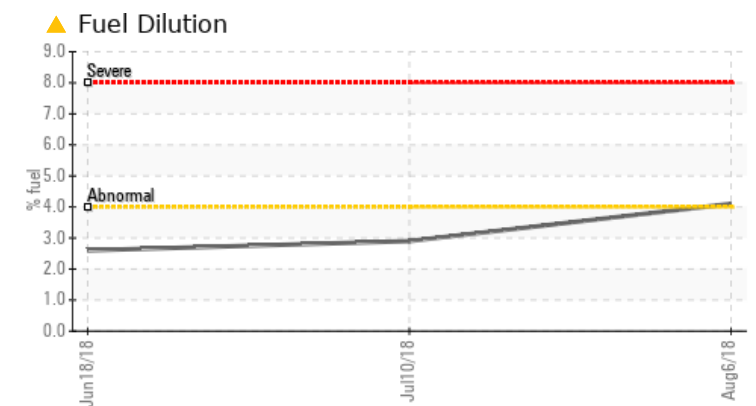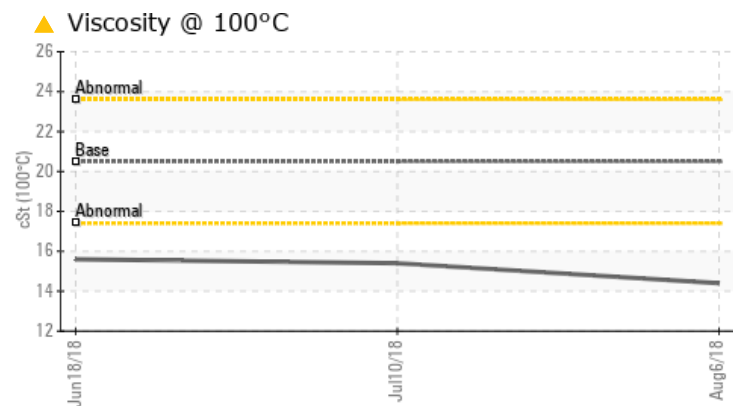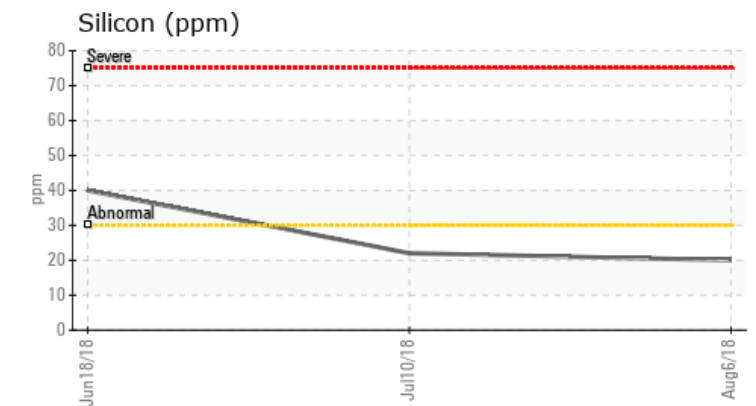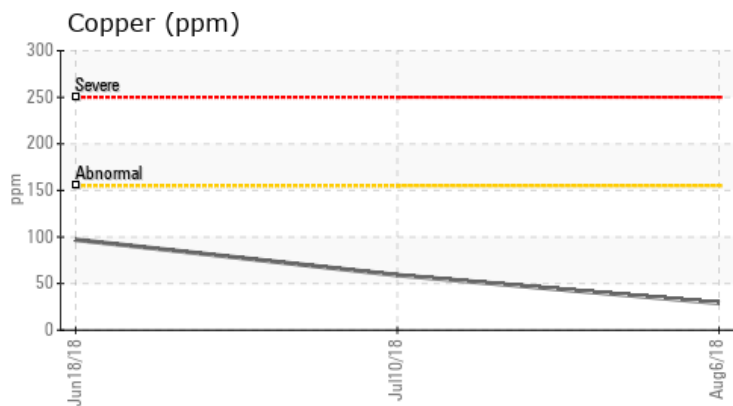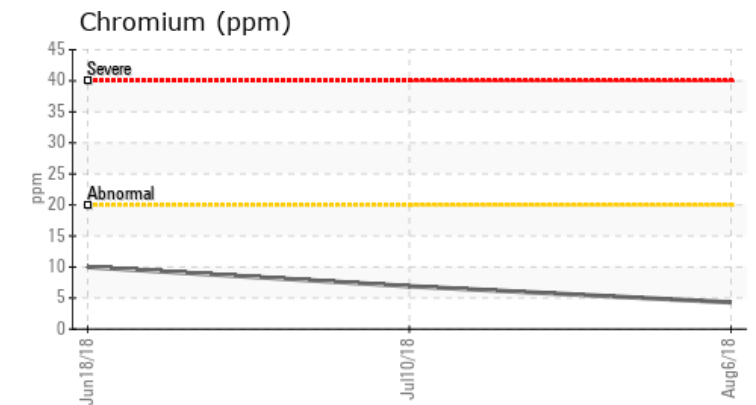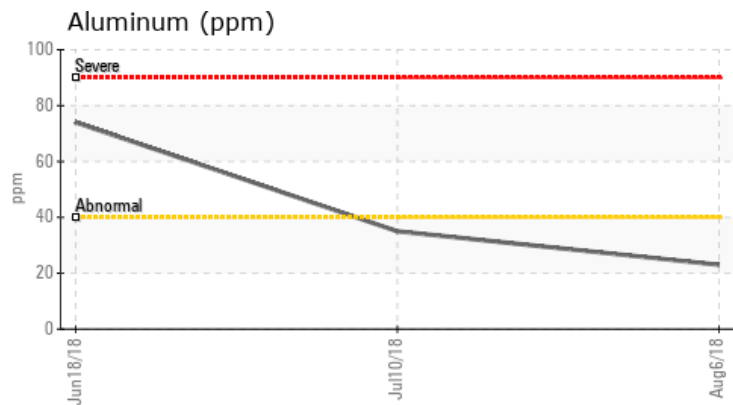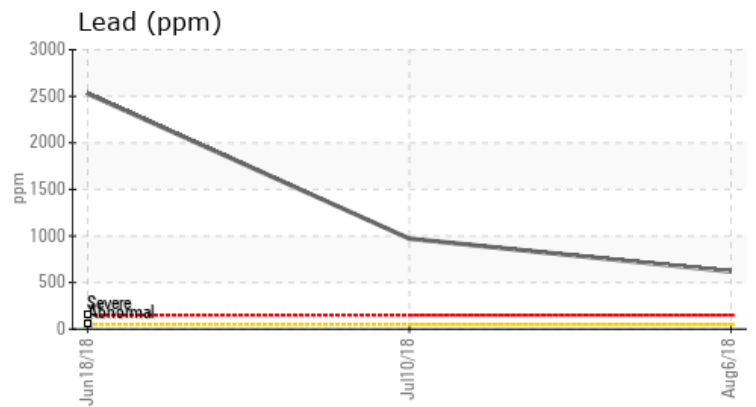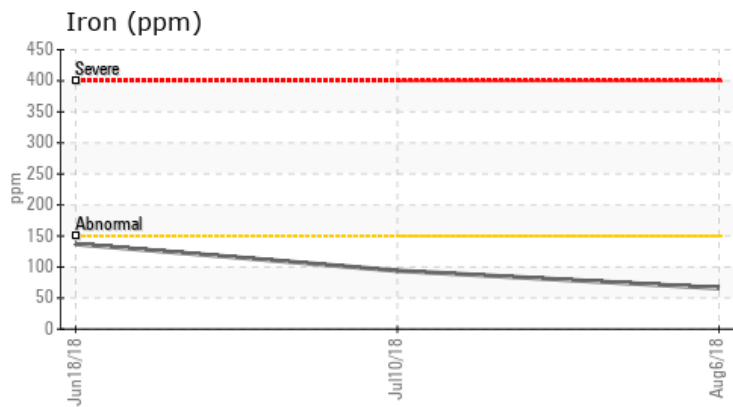

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC112686 **Received** : 13 Aug 2018  
**Lab Number** : 02233374 **Diagnosed** : 14 Aug 2018  
**Unique Number** : 4732528 **Diagnostician** : Kevin Marson  
**Test Package** : MOB 1 ( Additional Tests: FuelDilution, Glycol, PercentFuel, Visual )

**9042628 Canada Inc**  
 3755 - E Boul Matte  
 Brossard, QC  
 Canada J4Y 2P4  
 Contact: Pierre Beauchamp  
 support-tech@adrenalube.com  
 T: (514)999-5546  
 F:

To discuss diagnosis or test data, contact Technical Support at 1-800-268-2131.  
 To change component or sample information, contact Customer Service at 1-800-268-2131.